



Sterling Rail, Inc.®

P: 512-263-1953 | F: 512-263-9799 | www.SterlingRail.com

FOR SALE GP38M Locomotive #3842

- 16-645E Engine • AR10 Main Generator
- 26L Air Brake • M.U.able
- AAR Control Stand

Call for As Is or with Workscope Pricing

Location: NC

REF#FSL3463



Sterling Rail, Inc.®

2905 RR 620 North

Austin, TX 78734

P: 512-263-1953 | F: 512-263-9799

www.SterlingRail.com | info@SterlingRail.com

LOCOMOTIVE INSPECTION REPORT

DATE 12/5/11 LOCATION Elizabeth City, NC
 ROAD # 3842 MODEL: GP38M FRONT: SHORT - LONG NOSE: LOW - HIGH
 FRAME # _____ M.U.: YES - NO DYNAMIC: YES - NO
 WHEELS: 1 3" 2 3" 3 3" 4 3" 5 _____ 6 thin Flange on Rt. S
 BOX TYPE: 1 GG 2 GG 3 Hyatt 4 Hyatt 5 _____ 6 _____
 TRUCK TYPE: 1 GP CYL: HI 230A 2 _____ CYL: HI - LOW
 RIGGING PIN TYPE: 1. _____ 2. _____
 TRACTION MOTOR: IN - OUT 1 D77 2 D77 3 D77 4 D77 5 _____ 6 _____
 FUEL TANK SIZE: 2800 COUPLER TYPE: E DRAFT GEAR TYPE: 390/391
 PLOW TYPE: Snow PILOT TYPE: _____ GENERAL CONDITION: _____
 BOTTOM END: _____
 ENGINE TYPE: 16-645E S/N _____ E ENGINE BLOCK #: _____
 CONDITION: _____

CHECK FOR DEFECT TAG: YES - NO

TURBO: _____ S/N: _____ PART #: _____ CONDITION: _____
 DIFFUSOR CONDITION: _____
 PAINT EXTERIOR: Good Graded INTERIOR CAB: _____ ENGINE ROOM: _____
 AC CABINET: OK FAN FUSES: YES - NO
 AIR COMPRESSOR TYPE: low base Air-cooled CONDITION: Good
 AIR BRAKE TYPE: 26L CONDITION: Good
 MAIN GENERATOR TYPE: ARIO CONDITION: Good
 AUX. GENERATOR TYPE: 10KW CONDITION: Good
 BLOWER WHEEL TYPE: _____ CONDITION: _____
 FUEL PUMP: YES - NO OIL COOLER: YES - NO LOAD REG TYPE: _____
 DYN BRAKE/FAN: YES - NO 36 - 48"
 BELL: YES - NO HORN: YES - NO BATTERIES: IN - OUT - BROKEN
 COOLING FANS # BLADES TYPE
 1. YES - NO 36" - 48" 6 - 8 - 9 - 10 CAST - FAB
 2. YES - NO 36" - 48" 6 - 8 - 9 - 10 CAST - FAB
 3. YES - NO 36" - 48" 6 - 8 - 9 - 10 CAST - FAB
 4. YES - NO 36" - 48" 6 - 8 - 9 - 10 CAST - FAB
 RADIATORS: IN - OUT SOLDERED - MECHANICAL BOND
 TOILET TYPE: _____ WATER COOLER TYPE: _____ FIRE EXT: _____
 ELECTRICAL CABINET CONDITION: _____

WIRE INSULATION TYPE: _____ CONDITION: _____
 CAB CONDITION: FLOOR: _____ GLASS: _____ SEATS: _____
 CONTROL STAND TYPE: AAR CONDITION: _____ RADIO EQUIP: _____
 SPEED RECORDER TYPE: _____ ANGLE DRIVE TYPE: _____
 CARBODY CONDITION / OVERALL CONDITION: Good Carbody, Complete
Paint good but grubby

MISSING OR DAMAGED ITEMS: Rear Coupler Missing

Cab locked
1 Cooling fan missing
Battery 11-04
Axle gen missing
Head lights missing

INSPECTOR: _____

Sterling Rail, Inc.
 2905 RR 620 North
 Austin, TX 78734

P: 512-263-1953 | F: 512-263-9799

www.SterlingRail.com | info@SterlingRail.com

#3842 Inspection Report (Cont.)





#3842 Wheelsheet

Left Rim Thickness	Left flange Thickness	Left Flange Height	Left Rim Whtness G.	Right Rim Thickness	Right Flange Thickness	Right Flange Height	Right Rim Whtness G.
48	20	21	41	48	17	22	40
51	20	18	42	52	20	18	42
48	20	20	41	46	15	22	39
46	20	20	37	47	20	20	37

- Looks like most of the air equip. is there for shipping.
- #3 wheel has a 15/16 flange thickness. it will need to be cut.
- The rear coupler assy., Pin and retainer with cotter key are missing.
- Axle alt. missing.
- Control stand both air gages are missing.



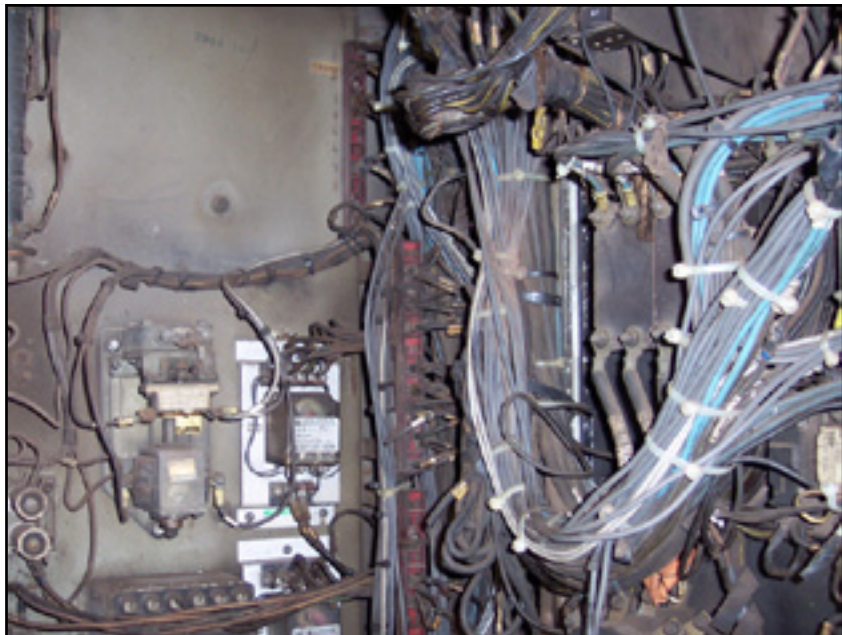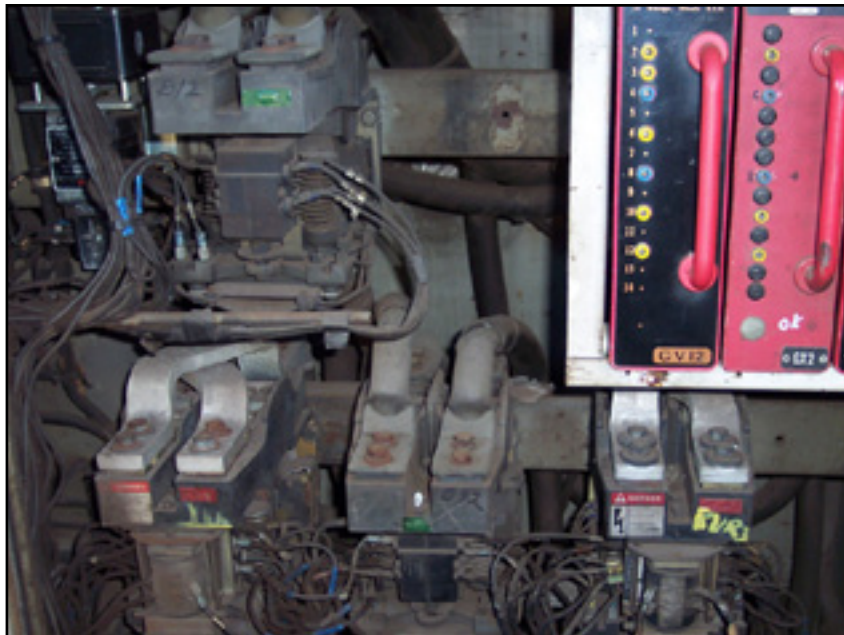

Sterling Rail, Inc.®

2905 RR 620 North
Austin, TX 78734

P: 512-263-1953 | F: 512-263-9799

www.SterlingRail.com | info@SterlingRail.com